

RELAY CODES & COMPONENTS LIST

GBW 13762

SIZE
F

SHEET
OF 1

UAX NZ 13 RINGING CODES FOR 5 PARTY LINES.

RELAY	BCC CODE	DIAG. FIG	NOTES	COMPT. DESIG. NATION	BPO CODE	NOTES
PL	21167P			CI	MC N° 101	
X	20985P			C2-C7	MC N° 100	
Y	20986			(R1)	N° 6	
Z	20986			(R2)-(R7)	N° 6	
				MRI	1/12 AZ	
				CB	ELECTROLYTIC 1500µF	(PLESSLY TYPE CE22193/8)
				R8-R11	N° 12	
				R13A-E	N° 9	
				(R12)	ERIT CERAMIC	SCC11-
				(R14)	INSULATED (COLD	SCC13-1+
				(R15)	MOULD) TYPE	SCC1-2
				MR2	CV7026	SCC5-6
				MR3	CV7026	SCC7-8
				MR4	CV7026	SCC3-4
				MR5	CV7026	SCC9-10
				SCC	TYPE.145DN	
				SCA	P.O. N°121A	
				SCB		
				VTI-4	OC 20	MOUNTED ON HEAT SINKS
				CS	2/8/10AN	
				P	8WAY PLUG&SOCKET	(PAINTON-TYPE)
				T1	DRG.54043A	G.E.C. CODE OR
					DRG.JL950572/001	A.T.E. CODE
				L1	CP 50339	G.E.C. CODE
				T2	DRG.54533A	G.E.C. CODE
				R16	N° 9	NZPO NOTE. A


NOTES A SPECIAL FACTORS OF SAFETY B SPECIAL ADJUSTMENTS C CCT POINTS OF MODIFICATIONS

NZ. NOTE. B :-

R16 WAS SHOWN AS N° 12

LAYOUT

R13E, R8, R9, R10, R11
R13A, R13B, R13C, R13D.

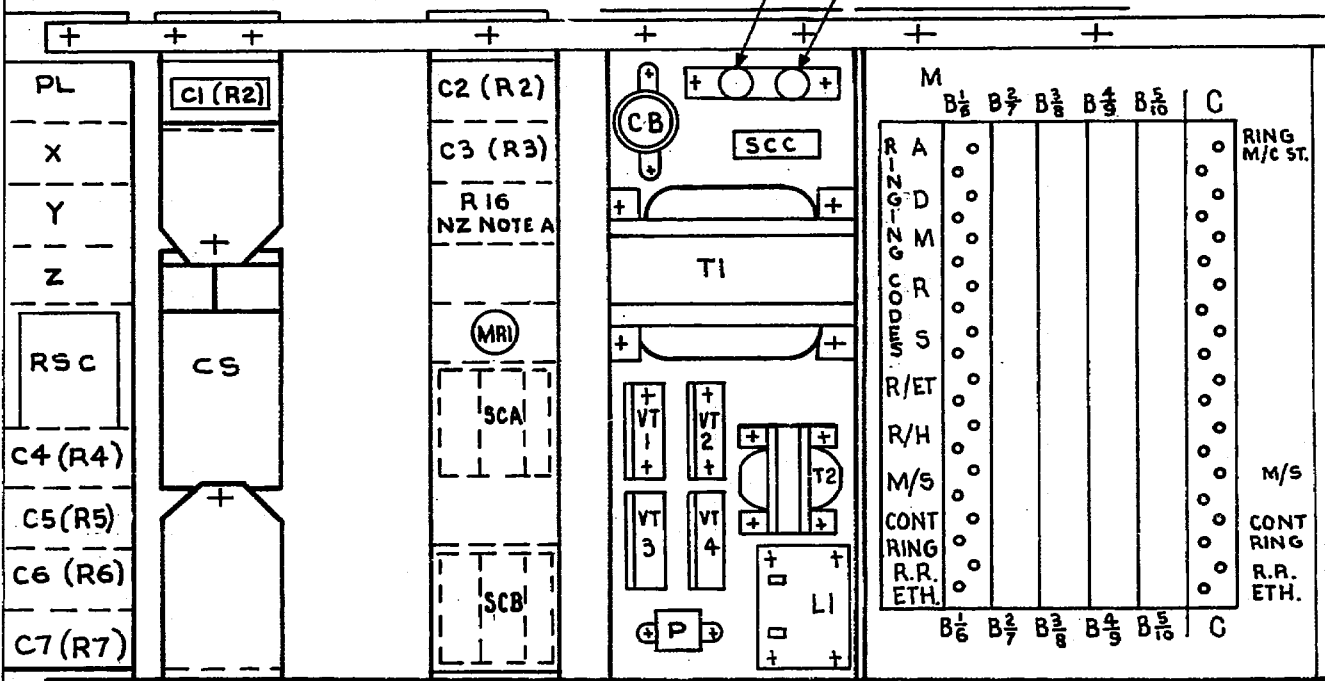

N.Z. NOTE. A :- WHERE EXCESSIVE OVERHEATING OF CS UNISELECTOR COIL IS EXPERIENCED ADD RESISTOR R16. SEE GBW. 13762.

ISS. 1.4.11.64 SCC WAS SCA (94468)	NG.	DLM	DLM	DLM	DLM	AP	ORIGINATED BY	G.E.C.
ISS. 2.15.11.65 NZPO NOTE A ADDED (30129)							DATE	4-11-64
ISS. 2A.14.12.71 LINK STRIP WAS NOT SHOWN IN DETAIL (30228)							SIGNED FOR COMMITTEE	J.M.L.
ISS. 3A.16.2.72 A.T.E. CODE FOR T1 WAS NOT SHOWN (30228)								
ISS. 4A.16.2.72 NZ NOTE. B. ADD. (30403)								
ISS. 4B.13.4.72 C9 C10 & C11 ADDED (REF NZMSL) (176088)								
ISS. 5C.29.7.78								
NZPO (47209) 29-1-65								