SIZE F | SHEET 1 OF 1

RELAY CODES & COMPONENTS LIST, GBW 16110

ANSWERING RELAY CIRCUIT FOR USE WITH ARTIFICIAL TRAFFIC EQUIPMENT

2000 TYPE

RELAY	B.C.C. CODE	DIAG. FIG.	NOTES
SC	50163	1A	
ST	50161	"	
STA	50162	"	
TP	50216 pd	"	C1
RA	COIL RET. 1523	"	

RESR. CODES WERE DIFF. C1 WAS HUNTS GB116. C.CLAMP 51C WAS SHOWN. (30227)	APPD. D.L.M.	
ISSUE. 9. 16·2·72 WATTAGE 'R' TOLERANCES FOR R7, R8 & R1A WERE NOT SHOWN. (30097)	D.L.M.	
ISSUE 10 5-5-72 VT1, VT2 WERE BCZ11 ALTERNATIVE CODE FOR C1 WAS NOT SHOWN. (122768)		
ISSUE 11 27·5·74	J.H.E.	

COMPT DESIGNATION	BPO CODE	NOTES
R1A-D	RFG5-E (5%)	
R1E	RFG5-D (2%)	
R2	RFG5-E (5%)	
R3	RFG5-E (1%)	
R4	RFG5-C (2%)	
R5	RFG5-D (1%)	
R6	RFG5-C (5%)	
R7	Nº 40 (6W 2½%)	
R8	Nº 12 (2W 2½%)	
MR1	[illegible] 31	TEXA[illegible] INSTRUMENTS
MR2	IS 131	CODE
VT1, VT2	CV 9507 OR EQUIV	
VT3	MULLARD ACY 20	
C1	S.E.I. 05 PL106J (5%	
	ERIE 52001-000-0106-0J-0630	
SCA, SCB	STRIP CONN. Nº145	
SCD	" " "	
TJ	JACK TEST. Nº21C/4	
PLUG	Nº 6	
P/MTG	PO.MTG. F151/20BH	
SCC	STRIP CONN. 121C	
R9	RFG5-E (5%)	
R1A	Nº. 26 GD (¼W 5%)	
R1B	RFG5-D (5%)	

NOTES:- A. SPECIAL FACTORS OF SAFETY. B. SPECIAL ADJUSTMENTS. C. CCT. POINTS OR MODIFICATIONS

LAYOUT.

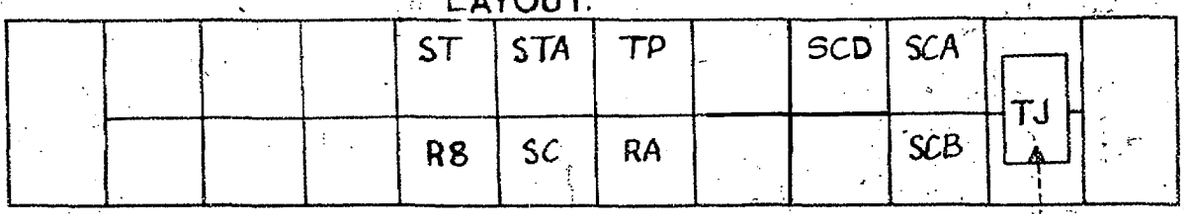

SCA

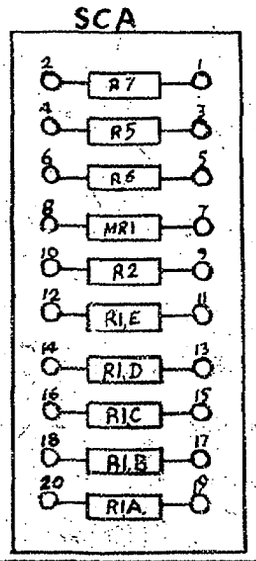

SCB

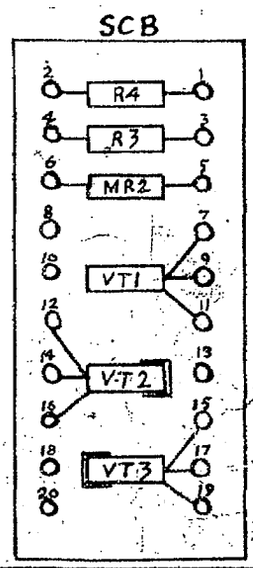

SCD

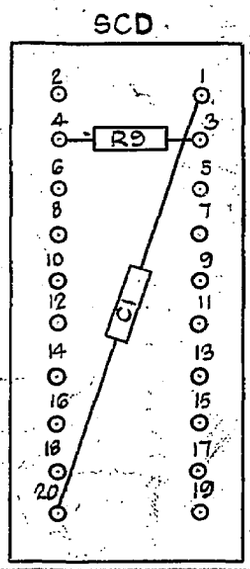

SCC MTD. AT REAR OF TJ.

NOTE. C1 PRIOR TO ISS-6 OF THE G.B.W. THE CODE OF RELAY TP WAS 50160.

ISSUE 1 29-3-63 R7 WAS 40S C1 WAS WP45	ISSUE 2 25-7-63 NEW SCC SHOWING MTG OF C1 ADDED ORIG. SCC NOW SCD (91649)	ISSUE 3 26-10-64 REFS. STRIP CONNS. SCC & SCD REVERSED (47243)	ISSUE 4 19-11-64 RESISTOR R9 ADDED (53466)	ISSUE 5 8-2-66 MR1 WAS MS1H MR2 WAS CG81-H (58338)	ISSUE 6 15.9.66 RELAY TP WAS 50160 (58201)	ISS 7 25-11-66 NOTE C1 ADDED (46786)	ISS 8 27-1-67

ORIGINATED BY	A.E.I.
DATE	25-3-63
SIGNED FOR COMMITTEE	[illegible]

N.Z.P.O. (69231) 3-10-63 A.G.