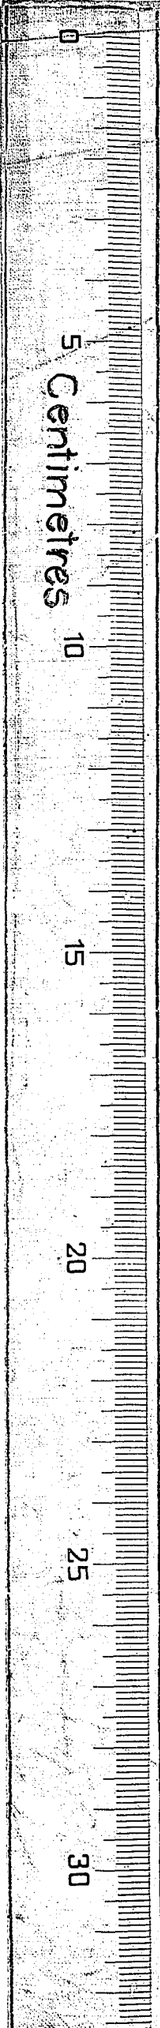

FIG. 2A.

B/W LINES TO AUTO TEST DESK

TO SIMILAR TERMINALS ON OTHER POSITIONS

FIG. 2D. TEST DESK NOTE 4.

FROM TELEPHONE CCT. LISTENING TAP NOTE 4.

FROM TELEPHONE CCT. SPEAK KEY GBW 10440 OR EQUIV.

FIG. 2C. TEST DESK.

FIG. 2B. TEST DESK.

FIG. 1. M.A.R.

I.D.F. MULT

FROM LINE CCT GBW 10752 OR EQUIV.

DESK STRIP CONN

FROM PILOT CCT GBW 11440 OR EQUIV.

BATT FUSE 50V 8K LP1b etc.

BATT FUSE 50V 8K R1b etc.

BATT. 8K. 20 SWG. FUSE (2B) Ae-Be-R1b etc.

ETH. R. 20 SWG ETH BAR (2A) A22-CA1 etc.

EARTH R. POSN. ETH. KA6 etc

ANSWER (KA) / 3 + CALL (KC) / 3

SLOW RELEASE

SLOW OPERATE

NOTES

1. FUSING. FIG. 1. 1·5A PER 10 CCTS.
   FIG. 2B OR 2C 1·5A PER 10 CCTS.
2. ALL WIRING TO BE 23 SWG UNLESS OTHERWISE SPECIFIED.
3. FOR DESKS FITTED WITH 6V LAMPS ADD CONNECTIONS SHOWN THUS —1—1— TO FIG. 2B.
   " " " " 50V " " " " " " —1—1— " " 2C.
4. WHEN USED WITH TELEPHONE CIRCUIT HAVING SEPARATE LISTENING & SPEAKING TAPS OMIT FIG. 2D. & ADD CONNECTIONS SHOWN. —o—o—

AMENDMENT PARTICULARS	(6603)	ISSUE 1	DATE 8:1:54	APPD CGT

DRAWN	CHECKED	WIRING	CIRCUIT
NZPO			

TEST DESK
BOTHWAY LINES TO AUTO
NEW PLYMOUTH EXCHANGE.

REF: | SIZE S | 50V | E

GBW 13790