
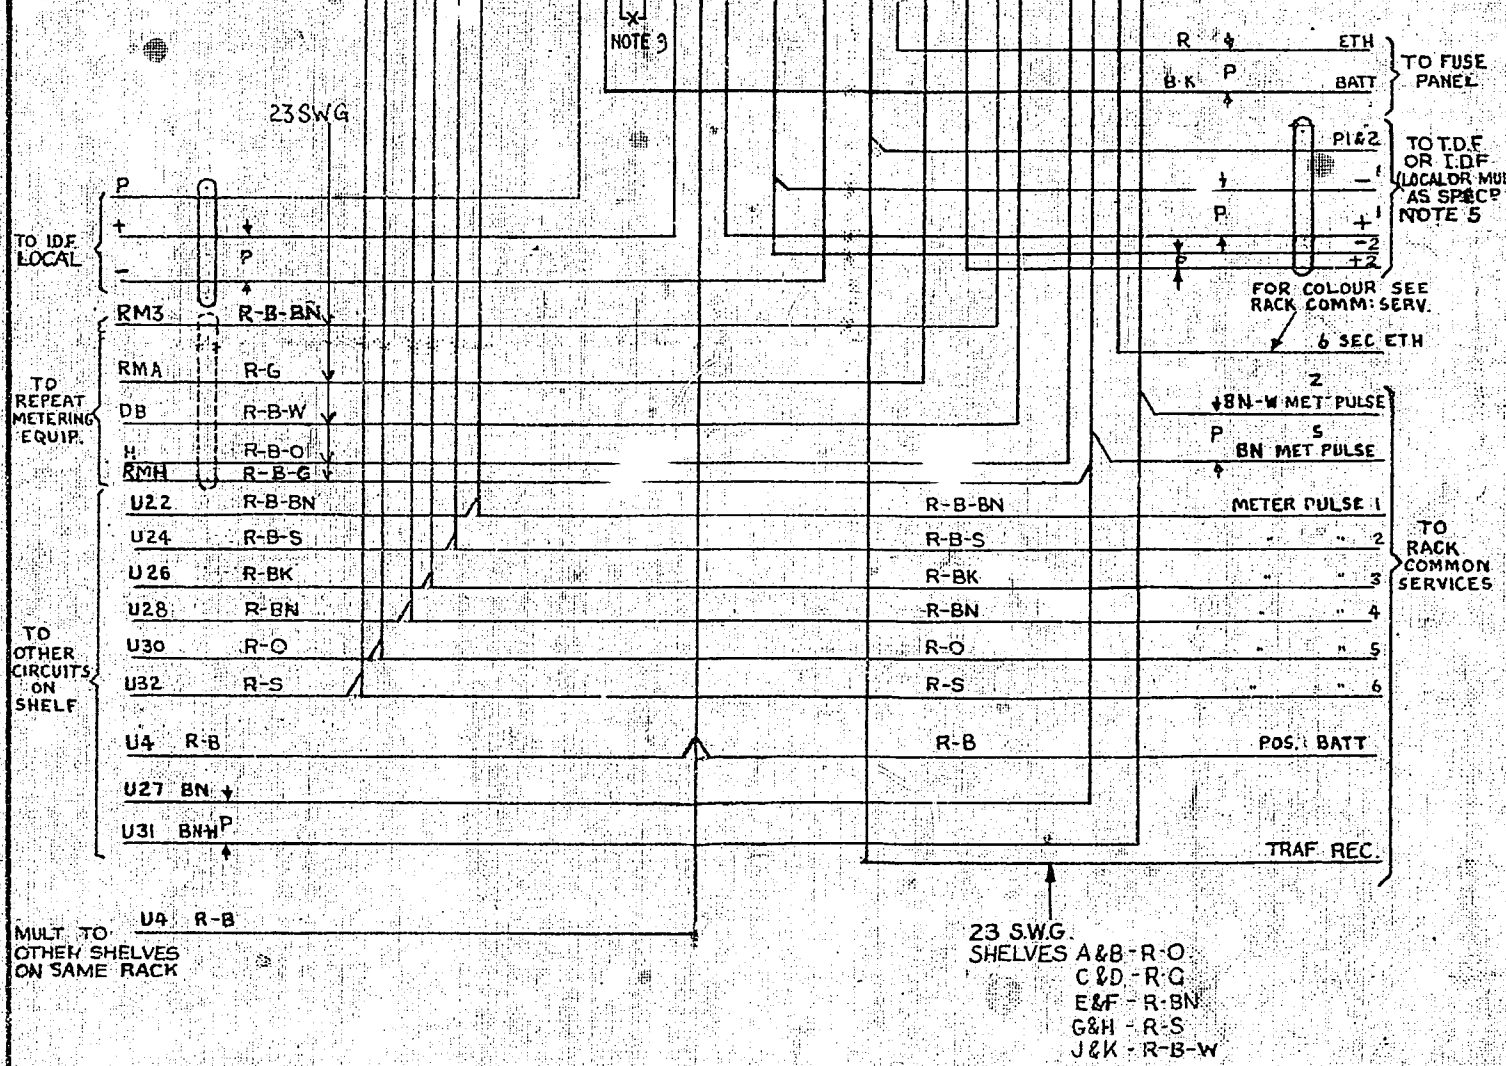


0
5 Centimetres
10
15
20
25
30

AS SEEN FROM REAR

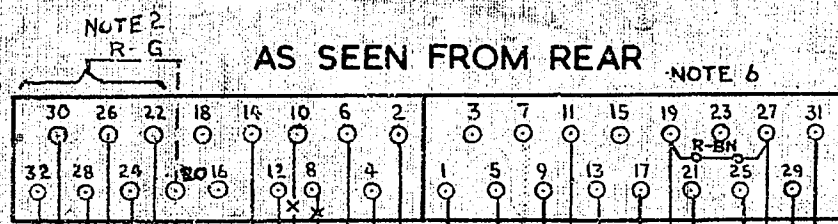

MULT TO OTHER SHELVES ON SAME RACK

23 SWG SHELVES
A & B - R-O
C & D - R-G
E & F - R-BN
G & H - R-S
J & K - R-B-W

NOTES

1. ALL WIRES NOT OTHERWISE SPECIFIED TO BE 20 S.W.G.
2. CONNECT U20 TO U22, U24, U26, U28, U30 OR U32 FOR APPROPRIATE METER PULSE.
3. STRAP BETWEEN U-PTS 8 & 10 TO BE REMOVED WHEN THE JUNCTION RESISTANCE IS LESS THAN 200Ω.
4. JACK POINTS 9 & 11 TO MAKE CONTACT WHEN RELAY SET IS REMOVED.
5. THESE LEADS ARE CABLED TO THE T.D.F OR I.D.F. EXCEPT UNDER FULL AVAILABILITY CONDITIONS WHEN THE TERMINALS ON THE T.D.F OR I.D.F. ARE REPLACED BY TERMINALS ON THE GROUP SELECTOR BANK MULT STRIP WHERE THERE ARE SEPARATE P1 AND P2 TERMINALS AND 6 WIRE CIRCUITS ARE CABLED DIRECT.
6. STRAP U19-U27 WHEN REPEAT METERING EQUIPT. IS NOT REQUIRED.

				AUTOMATIC TO AUTOMATIC REPEATER O/G TO DEPENDENT TERMINAL N.Z. CAX VIA JUNCTION RELAY SET. FIXED FEE 1.6 UNITS W/- REPEAT METERING MAIN AUTOMATIC EXCHANGE	
GBU 14061 DELETED	(66551)	3	21.3.63	DBH	
TNA LEAD ON U7 DELETED. 14061 ADDED (56723)	(42061)	2	23.2.62	DBH	
		1	1.3.55	DBH	
AMENDMENT PARTICULARS		ISSUE DATE	APPD.	50V S	
NZPO		DRAWN G.T.S.	CHECKED [Signature]	WIRING [Signature]	CIRCUIT [Signature]
GBU 14060					