
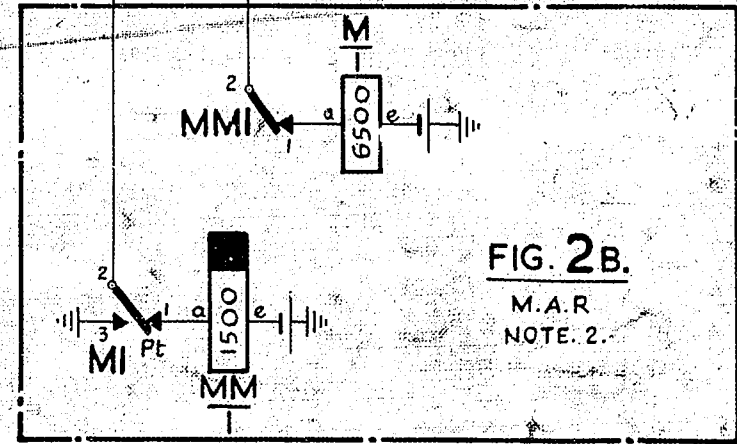


**FIG. 1. TEST RACK.**

1 PER. TEST SELECTOR

**FIG. 2A. M.A.R.**

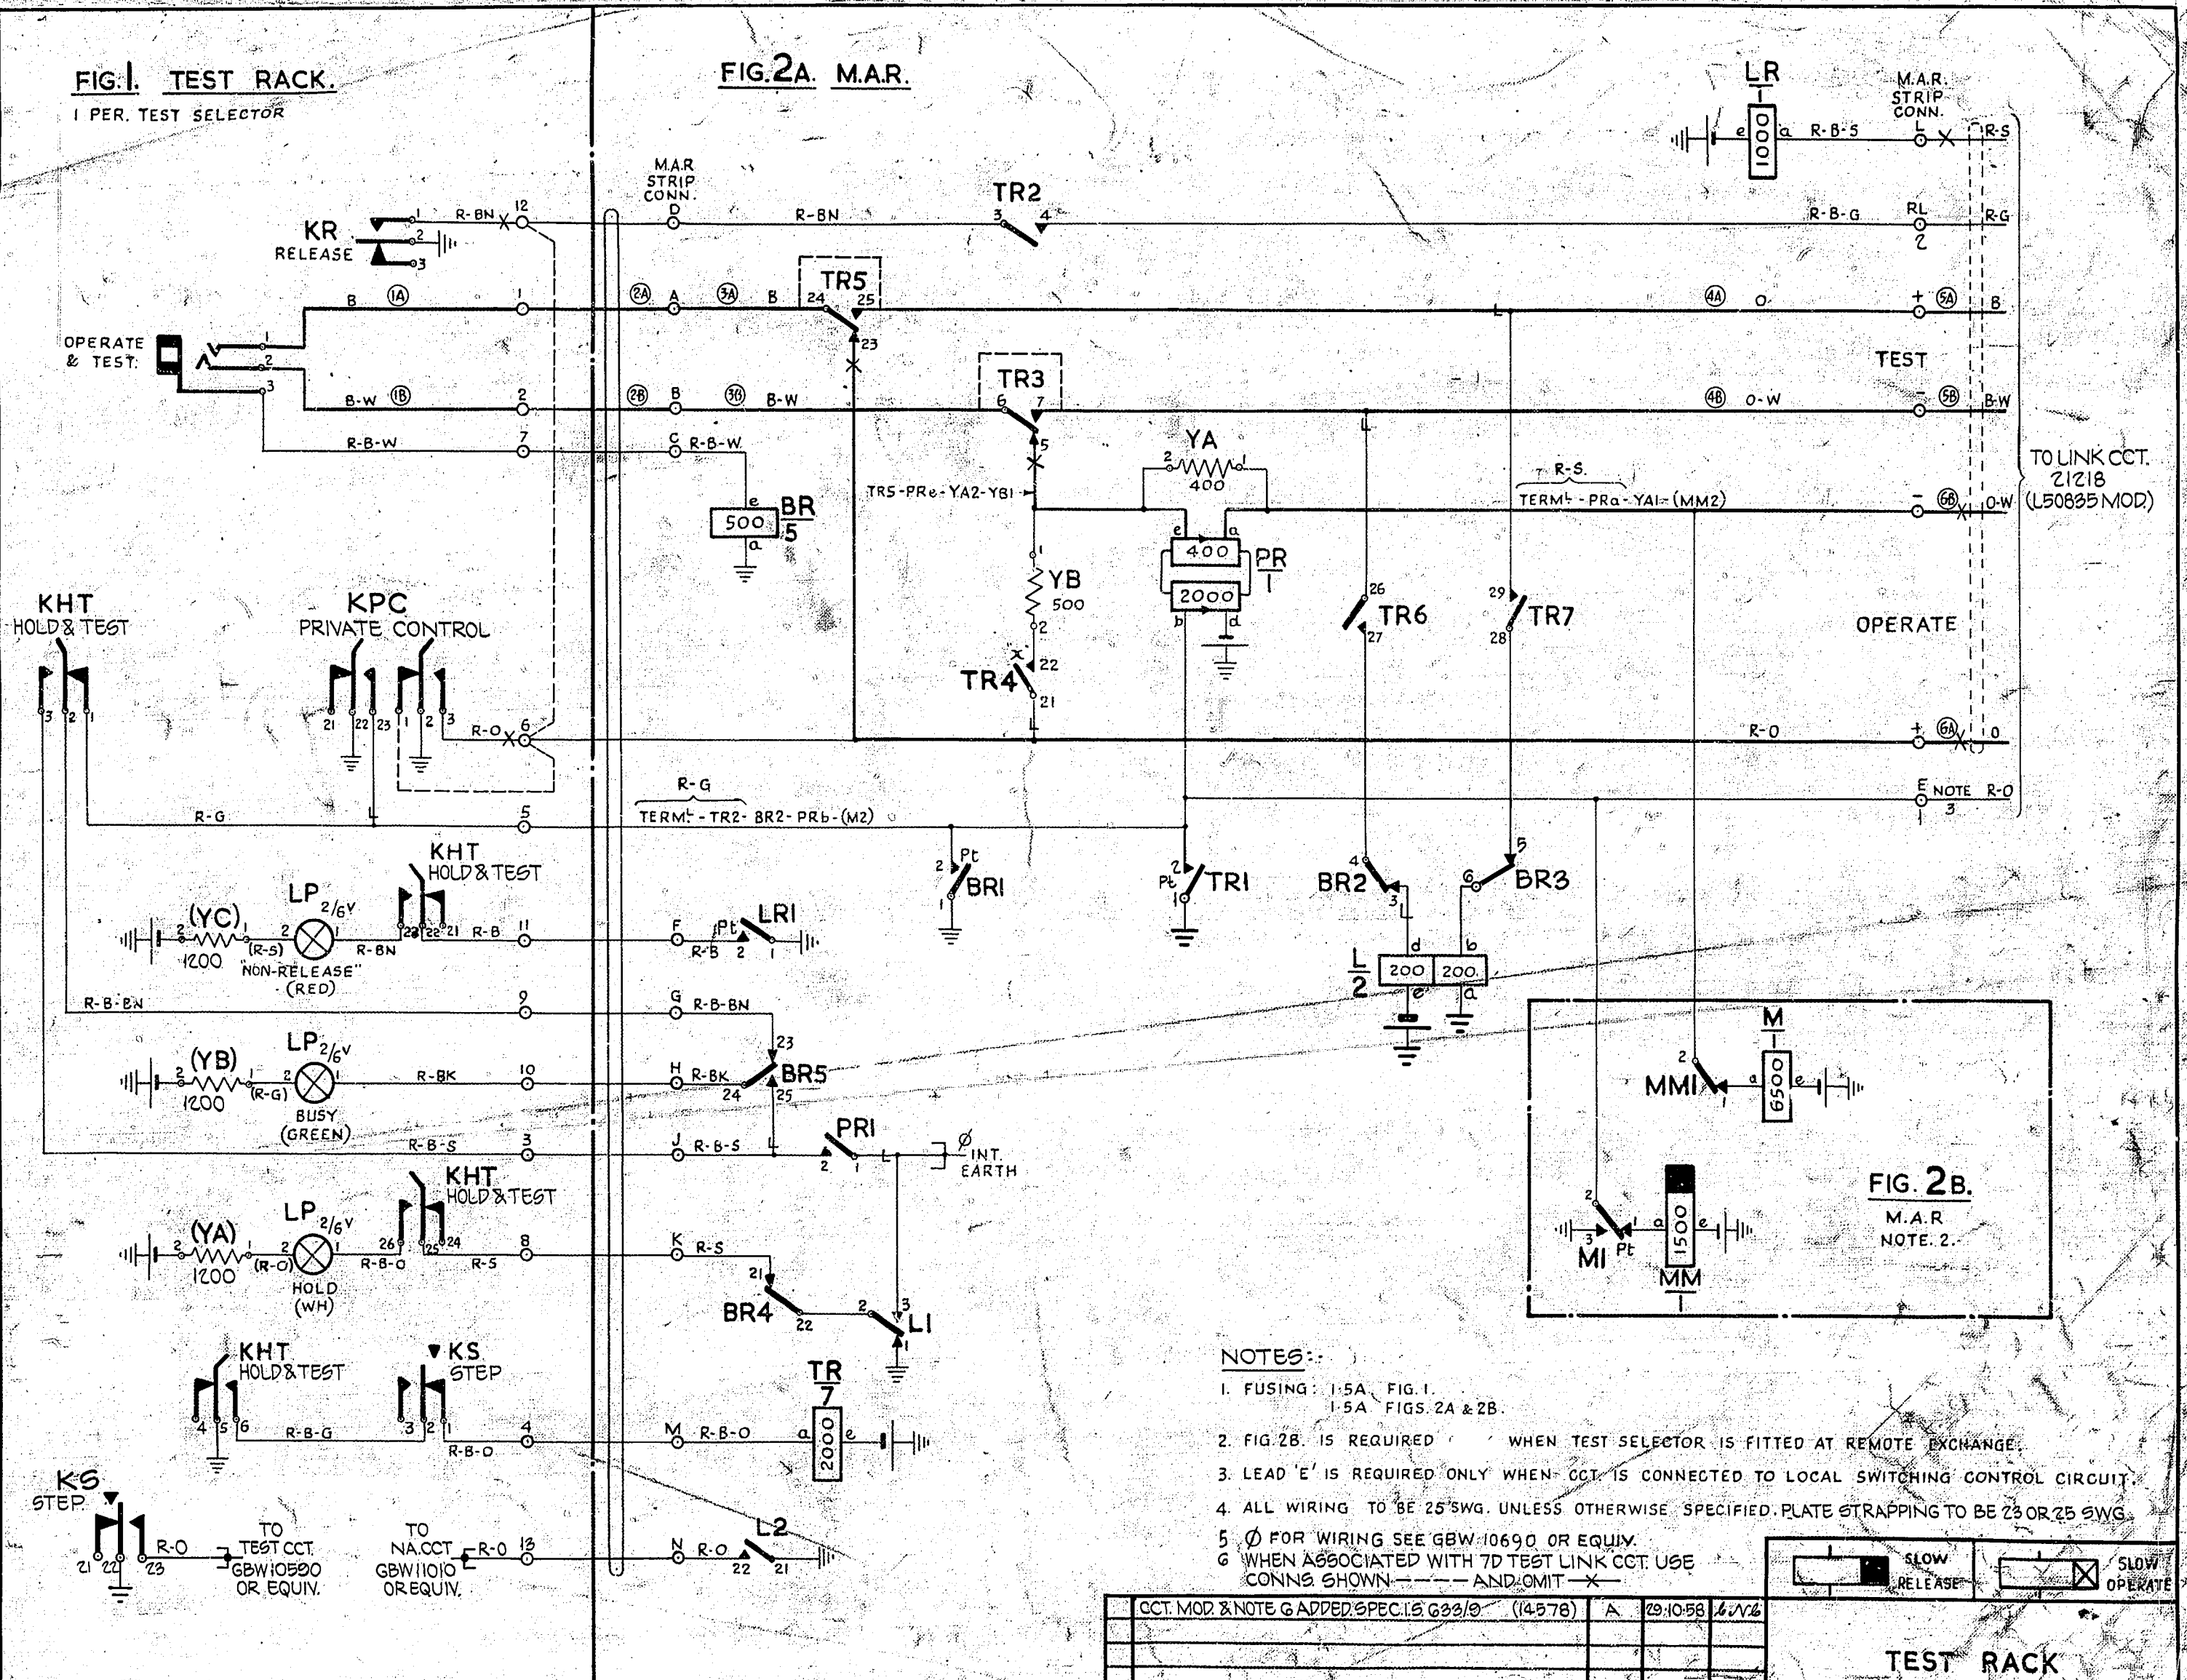

- NOTES:-**
1. FUSING: 1.5A FIG. 1.  
1.5A FIGS. 2A & 2B.
  2. FIG. 2B IS REQUIRED WHEN TEST SELECTOR IS FITTED AT REMOTE EXCHANGE.
  3. LEAD 'E' IS REQUIRED ONLY WHEN CCT IS CONNECTED TO LOCAL SWITCHING CONTROL CIRCUIT.
  4. ALL WIRING TO BE 25 SWG. UNLESS OTHERWISE SPECIFIED. PLATE STRAPPING TO BE 23 OR 25 SWG.
  5. Ø FOR WIRING SEE GBW 10690 OR EQUIV.
  6. WHEN ASSOCIATED WITH 7D TEST LINK CCT. USE CONNS SHOWN --- AND OMIT -X-

BATT. BK. 22 SWG. FUSE - YA2-YB2-YC2.  
EARTH. R. 22 SWG. ETH. BAR - KS22-KHT5-KR2-KPC2-KPC22

<b>KR2</b>	<b>KHT</b>	<b>KPC</b>	<b>KS</b>
23 22 21	23 22 21	23 22 21	23 22 21
PRIVATE CONTROL (KPC)	HOLD & TEST (KHT)	RELEASE (KR)	STEP (KS)
2	4	2	2

BATT. BK 20 SWG. FUSE (79) Le-TRe-LRe-PRd-(Me-MMe)  
EARTH R 20 SWG. ETH. BAR. (78) La-L2i-LI-TRI-LRI-BRI BRa-(M3)

<b>TR7</b>	<b>TR6</b>	<b>TR5</b>	<b>TR4</b>	<b>TR3</b>	<b>TR2</b>
7	26 27	24 25	21 22	6 7	3 4

CCT. MOD. & NOTE G ADDED SPEC. IS G33/0 (14578)	A	29.10.58	6.7.6
COMMONS ADDED ON TEST & NA CCT LEADS FIG. 1			
AMENDMENT PARTICULARS	ISSUE	DATE	APP.
NZ P.O.	DRAWN	CHECKED	WIRING CIRCUIT

**TEST RACK LINES TO TEST SELECTOR UPPER HUT**

SIZE S 50V

**GBW 10480 MOD. A**