

RELAY CODES & COMPONENTS LIST, GBW 16470


O/G LINE CIRCUIT FOR B/W WORKING (FOR USE WITH I/C LINE CIRCUIT) N.Z.S.S. AC N° 2T.

RELAY	B.C.C. CODE	DIAG. FIG.	NOTES	COMPT DESIG-NATION	B.P.O. CODE	NOTES
A	HSD 702		B	RI-R7	9	
AA	HSD 701		B	R9&R10	15A	NON INDUCTIVE
B	50199			R11	12	
BB	50183			C1	102C	
CD	50200			RX1-RX8	2	MOUNTED IN WIRING
CF	50198			MRI	DA000	JOSEPH LUCAS CODE
D	50135			T1	415A	A.E.I. CODE
DB	1767			T.C.F.T.I	CLEAR FORWARD	A.E.I. UNIT CODE :-
DD	5888				TIMEP GBW16710	UNIT ELECTRONIC 20A
RG	50202			R8	9A	
SA	5941P					
SB	1051					
SP	HSD 508		B			
SR	5942					

NOTES - A. SPECIAL FACTORS OF SAFETY. B. SPECIAL ADJUSTMENTS. C. CCT POINTS OR MODIFICATIONS.


LAYOUT

FRONT VIEW

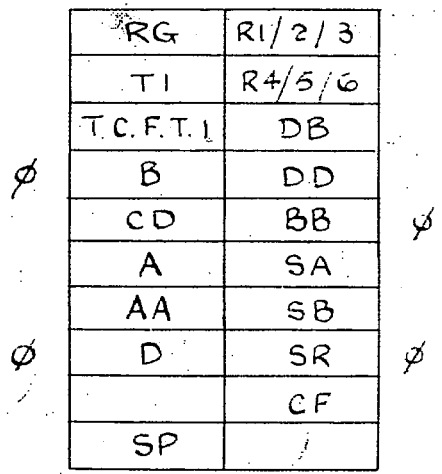

∅ = RELAY GUARD  
(MRI) MOUNTED IN WIRING

REAR VIEW

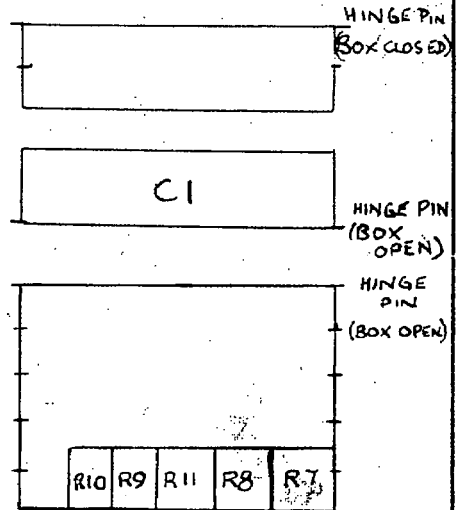

2 PLUGS 32 PT. P.O. 3205  
1 P.O. JACK TEST 21E MK4  
1 P.O. JACK TEST 21F MK4  
1 LINK 'N' RED

ISSUE 1. 1. APR 20-1-64 REVISED.	ISSUE 2. 9-9-64 SP WAS HSD 513	ISSUE 3. 2-12-64 TYPE'S. R8 WAS TYPE'S. CI WAS TYPE. 102	ISSUE 4. 22-3-65 LAYOUT OF RT-II REVISED	ISSUE 5. 7-5-65 LAYOUT OF RT-II CLARIFIED	ISSUE 6. 30-9-65 LAYOUT OF RT-II CORRECTED TITLE AMENDED	ISSUE 7. 18-10-65 RXG-B ADDED (83759)	ISSUE 8. 22-9-67
----------------------------------	--------------------------------	--	--	---	--	---------------------------------------	------------------

ORIGINATED BY	A.E.I.
DATE	20/1/64
SIGNED FOR COMMITTEE	ASH

Centimetres

20

25

96 ZN

17.8.66