


RELAY CODES & COMPONENTS LIST, GBW 16550  
 UNIDIRECTIONAL O/G LINE CIRCUIT N.Z. S.S. A.C. No 2T

RELAY	B.P.C. CODE	DIAG. FIG.	NOTES	COMPT. DESIGNATION	B.P.O. CODE	NOTES
A	HSD 702		B.	R1-R2	9	
B	50199			R9-R10	15A	
BB	50183			R17-R18	12	
CD	50200			R19	40	
CF	50201			R20	6	
D	50135			C1	102C	
DB	13504			C2	7204 MK 2	
DD	5888			C3	8017 B	
PC	50006P			C4	8017 B	
RG	50202			MRI	DA000	JO5 LUCAS CODE
SP	HSD 508		B.	T1	415A	A.E.I. CODE
SR	5942			T2	444A	A.E.I. CODE
TX	HSD 512		B.	T.A.R.1	TRANSISTOR RECR.	A.E.I. UNIT CODES:-
X	HSD 523		B.		GBW 16560	P.W.U. 45A (CV TRANSISTORS) OR 45C (MULLARD TRANSISTORS)
				T.C.F.T.1	CLEAR FORWARD	A.E.I. UNIT CODE:-
					TIMER GBW 16710	UNIT ELECTRONIC 20A
				R3	9A	
				SCA	MINIATURE MTG.	
				SCB	STRIP CINCH TYPE	CARR FASTENER CODE
				SCC	1/4 d.o.d.	
					A.E.I. DWG. OF ABOVE:-	TAG PLATE DS 4125 GRP. 2
				RX1-RX7	2	MOUNTED IN WIRING
				URI	RES. ASS. 1062	A.E.I. CODE
				R11,12,14-16	15	
				R4-R8	9	
				RVI	26E	

NOTES:- A. SPECIAL FACTORS OF SAFETY. B. SPECIAL ADJUSTMENTS. C. CCT. POINTS OR MODIFICATIONS.

LAYOUT FRONT VIEW REAR VIEW

R17 & R18	R9-12 & R14-R16
C1	RG/7/8
T.C.F.T.1	T1
X	T2
A	DB
B	SP
BB	RG
CD	SR
D	DD
TX	RVI *
PC	CF

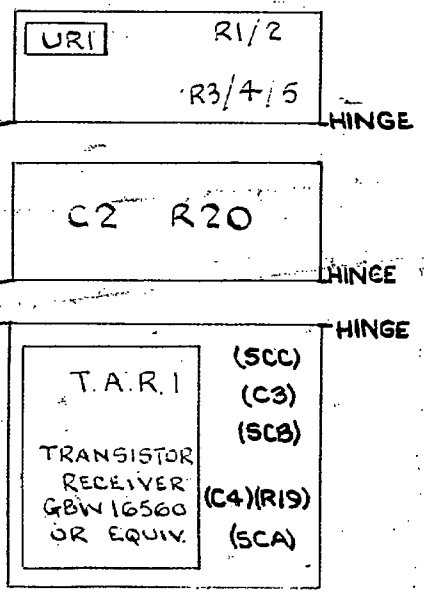

Ø = RELAY GUARD  
 (MRI) MOUNTED IN WIRING.  
 \*: RVI MOUNTED ON PO BRACKET  
 MTG. CV. + LOCKING NUT P.O.  
 SPINDLE LOCK No.1.

- 2 PLUGS 32 PT. P.O. 3205
- 1 P.O. JACK TEST 21E MK.4
- 1 P.O. JACK TEST 21F MK.4
- 1 LINK P.O. No. 6
- 1 LINK 'N' RED

ISSUE 1. APR 20-1-64 REVIS. SP.	ISSUE 2. 8-9-64 SP. WAS HSD 513 (47420)	ISSUE 3. 2.12.64 R9-10 WERE TYPE 15 R3 WAS TYPE 9 & C1 WAS TYPE 102 (92976)	ISSUE 4. 22.3.65 CODE OF LINK 'N' RED WAS LINK PO. No. 6 (47579)	ISSUE 5. 4.5.65 HINGE POSITIONS ADDED. TITLE AMENDED. STRIP CONNS. IN RECEIVER BOX INTERCHANGED	ISS. 6. 10.1.66 R13 DELETED RVI & RX5-7 ADDED. (83636)	ISS. 7. 22.5.67	ORIGINATED BY A.E.I.
							DATE 20/1/64
							SIGNED FOR COMMITTEE A.E.H.

5 Centimetres 10 15 20 25 30