


FIG.1. TEST RACK.

1 PER TEST SELECTOR.



FIG.2A. M.A.R.

0  
5 Centimetres  
10  
15  
20  
25  
30

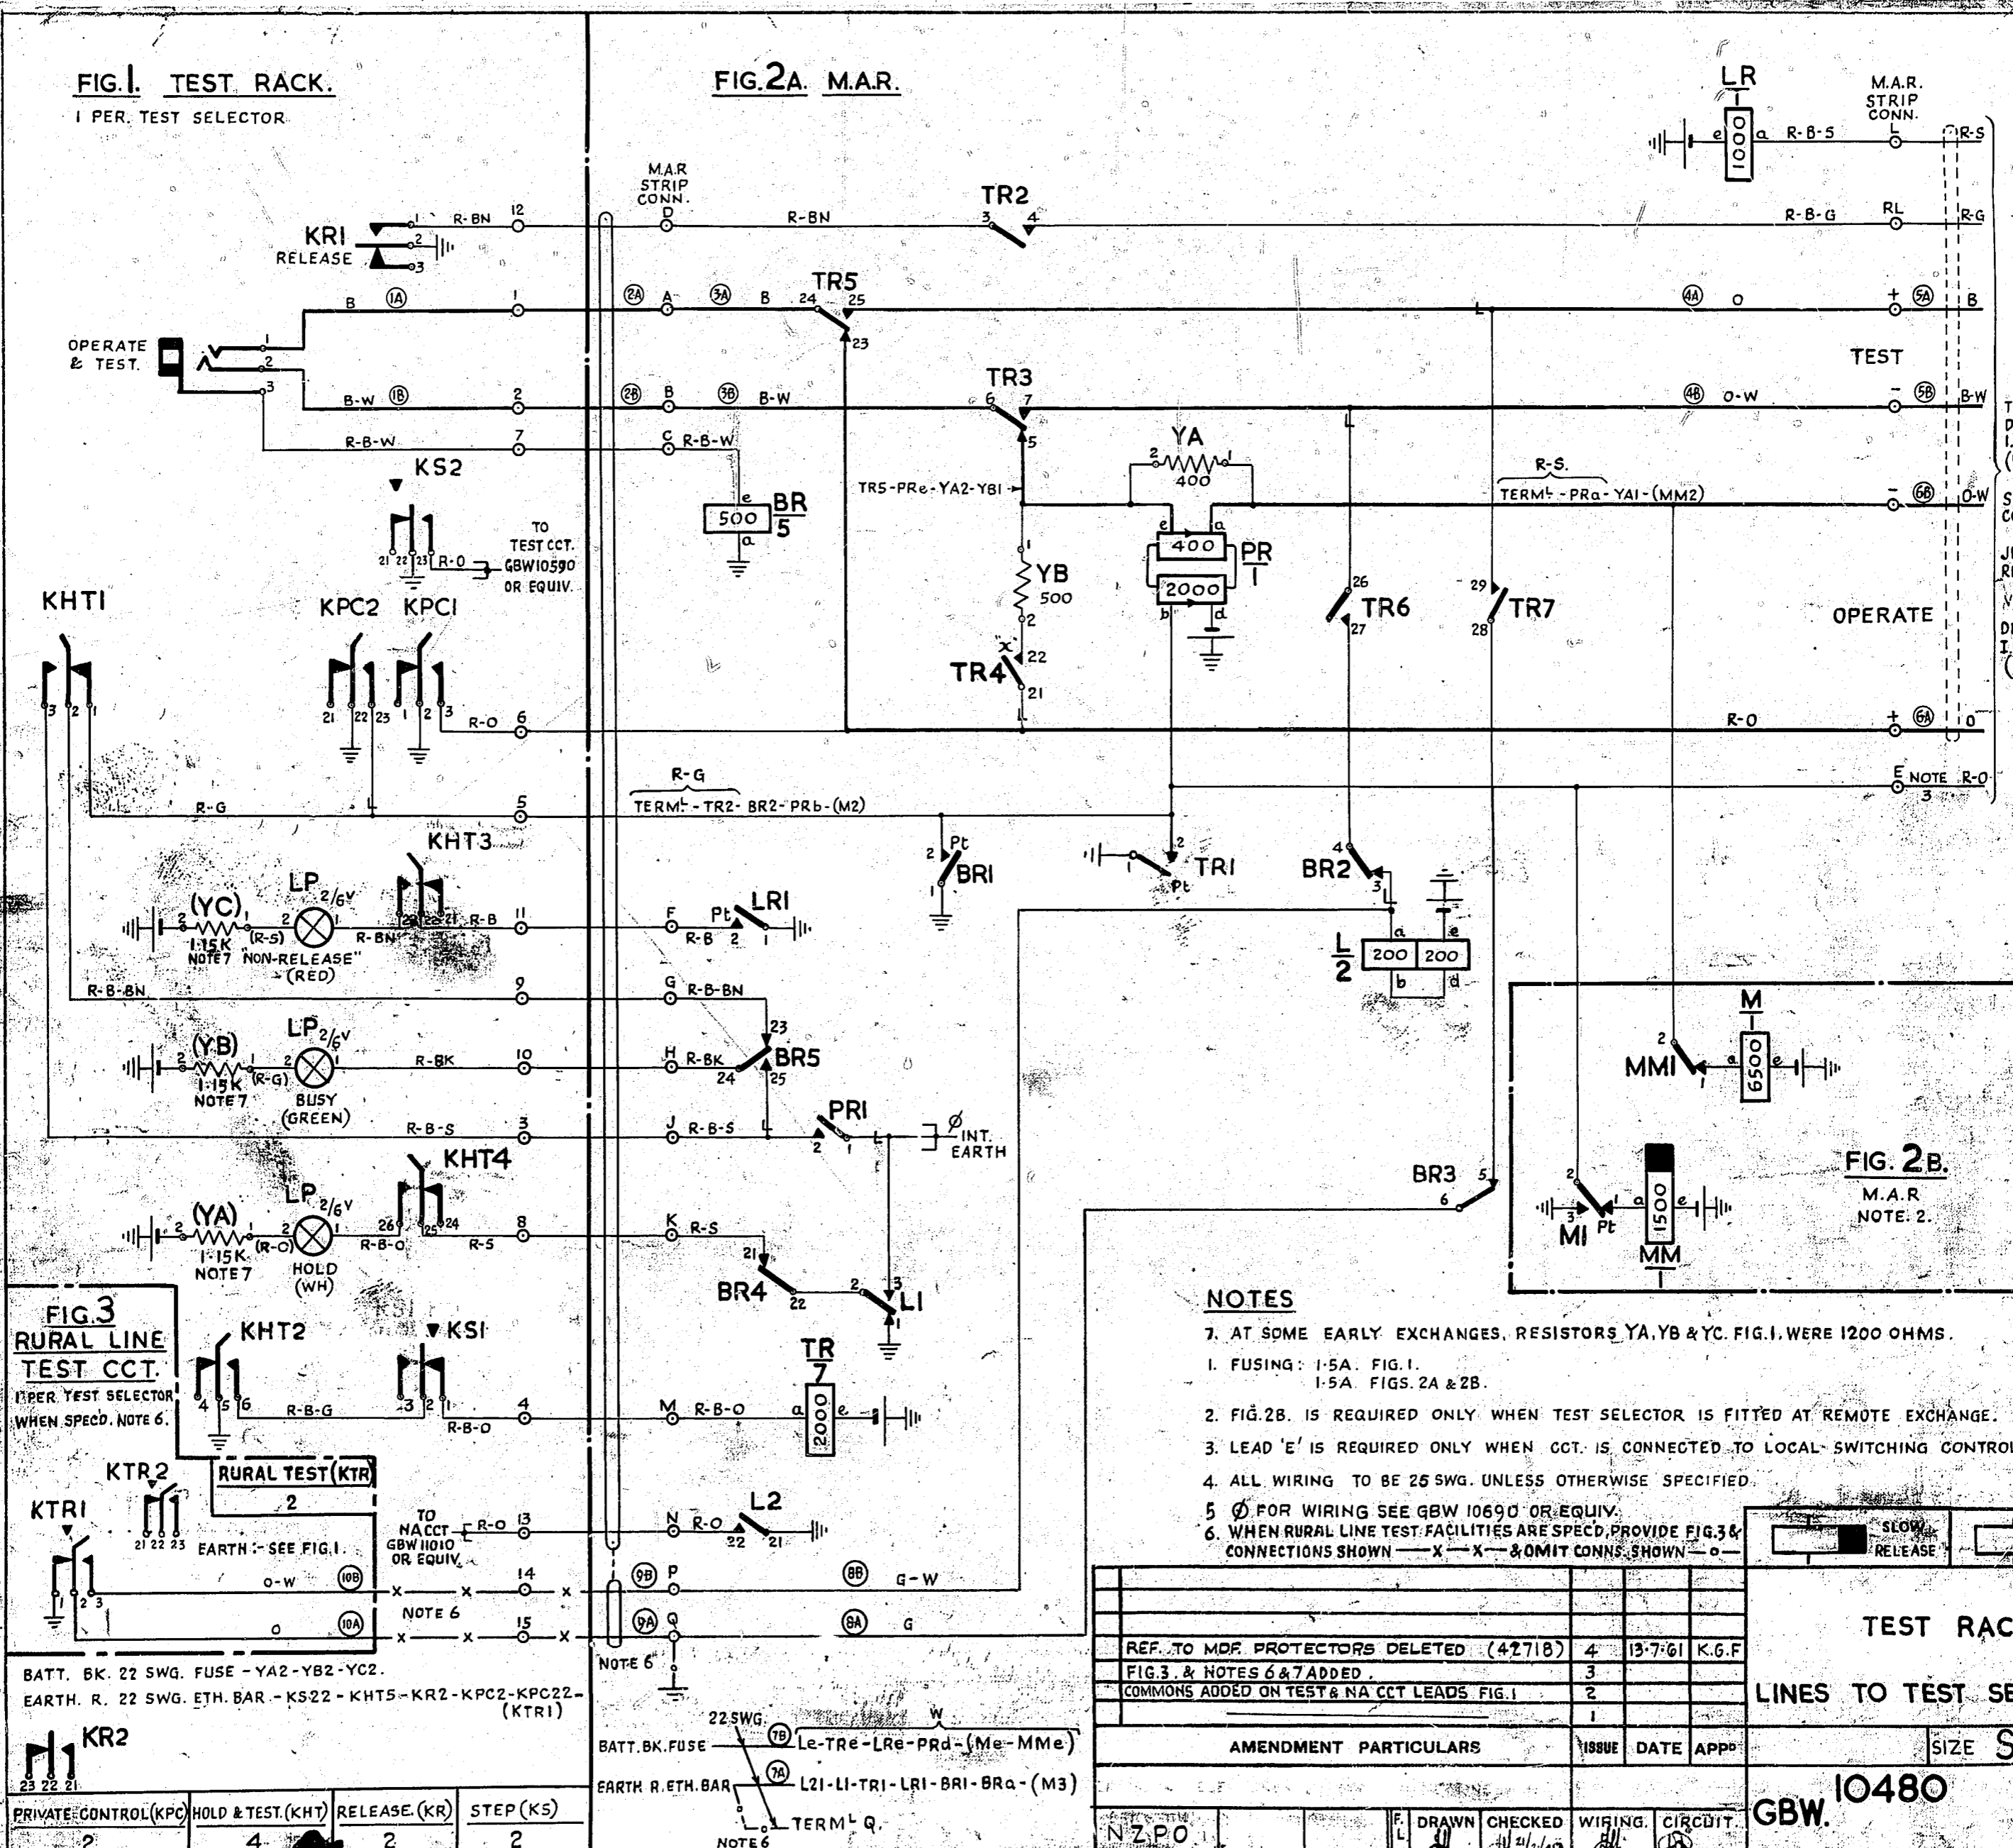

TO TEST SELECTOR DIRECT OR VIA I.D.F. LOCAL (WHEN SPEC'D) OR TO SWITCHING CONTROL CCT. OR TO JUNCTION TO REMOTE EXCH. VIA M.D.F. DIRECT OR VIA I.D.F. LOCAL (WHEN SPEC'D)

FIG.3 RURAL LINE TEST CCT. 1 PER TEST SELECTOR WHEN SPEC'D. NOTE 6.

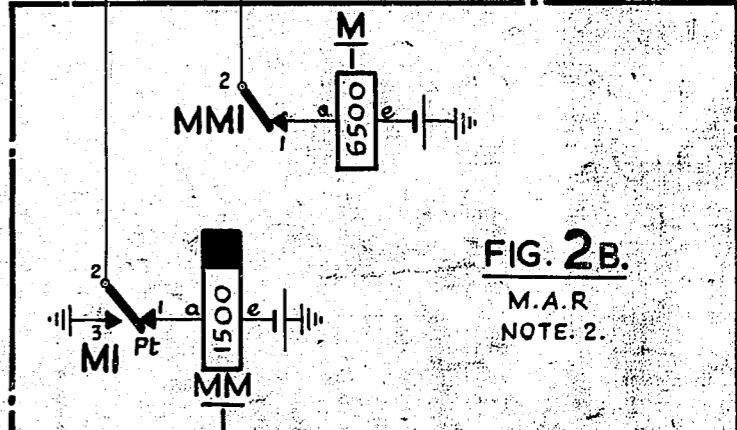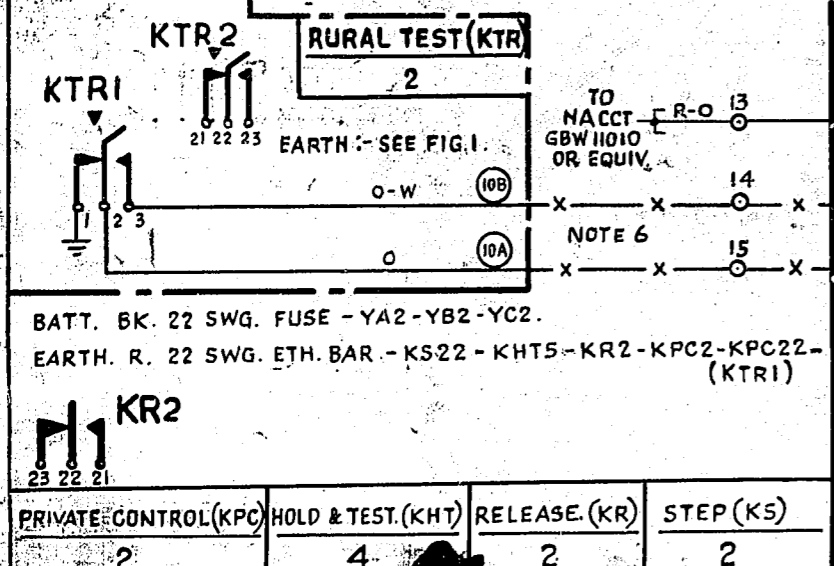

NOTES

7. AT SOME EARLY EXCHANGES, RESISTORS YA, YB & YC, FIG.1, WERE 1200 OHMS.
1. FUSING: 1.5A, FIG.1. 1.5A, FIGS. 2A & 2B.
2. FIG.2B. IS REQUIRED ONLY WHEN TEST SELECTOR IS FITTED AT REMOTE EXCHANGE.
3. LEAD 'E' IS REQUIRED ONLY WHEN CCT. IS CONNECTED TO LOCAL SWITCHING CONTROL CIRCUIT.
4. ALL WIRING TO BE 25 SWG. UNLESS OTHERWISE SPECIFIED.
5. ⌀ FOR WIRING SEE GBW 10690 OR EQUIV.
6. WHEN RURAL LINE TEST FACILITIES ARE SPEC'D, PROVIDE FIG.3 & CONNECTIONS SHOWN — X — X — & OMIT CONNS. SHOWN — ○ —

BATT. BK. 22 SWG. FUSE - YA2-YB2-YC2.	
EARTH. R. 22 SWG. ETH. BAR - KS22 - KHT5 - KR2 - KPC2 - KPC22 - (KTR1)	
BATT. BK. FUSE	22 SWG. W
EARTH R. ETH. BAR	22 SWG. W
PRIVATE CONTROL (KPC)	2
HOLD & TEST (KHT)	4
RELEASE (KR)	2
STEP (KS)	2

REF. TO MDR. PROTECTORS DELETED (42718)	4	13.7.61	K.G.F.
FIG.3. & NOTES 6 & 7 ADDED.	3		
COMMONS ADDED ON TEST & NA CCT LEADS FIG.1	2		
AMENDMENT PARTICULARS	ISSUE	DATE	APP'D
NZPO			
DRAWN	CHECKED	WIRING	CIRCUIT

TEST RACK

LINES TO TEST SELECTOR.

SIZE S 50V E

GBW. 10480