

FOR SEQUENCE OF MULTIPLES & WIRING OF OUTLETS SEE EXTENSION LINE CIRCUIT GBW13210 OR EQUIV

TO REQUIRED FACILITY

FROM BANK MULT-STRIP CONN GBW13160, 13180 OR EQUIV. (PREFIX DIGIT ALLOCATED BY NZ-PO) OR U'15 OF PRECEDING CCT

TO U POINT 13 OF NEXT FINDER. CCT(ODD CTS R-G-EVEN CTS R-O) U'POINT OF LAST CCT TO BE STRAPPED TO U'11.

EXPLANATORY

NOTE 3
EF25 OR EF50
5 5+5
EFd.m

FIG. 1B
LINE-FINDER

FOR BATT & ETH. SEE FIG. 1A.

- NOTES:
- 1 FUSE 1.5A PER CIRCUIT
 - 2 SHELF JACK UPOINTS 13-15, 17-19, 75-77, 76-78, 79-81 & 80-82 MAKE CONTACT WHEN RELAYSET IS REMOVED.
 - 3 25 POINT UNISELECTORS ON 5+20 EQUIPMENT. 50 POINT UNISELECTORS ON 7+35 & 10+49 EQUIPMENT
 - 4 Ø FOR WIRING SEE GBW13280 OR GBW13300 OR EQUIVS
 - 5 ALL WIRING TO BE 0.5mm UNLESS OTHERWISE SPECIFIED
 - 6 THESE STRAPS ENSURE CONTINUITY FOR MAINS FAIL EXTENSIONS IN CASES WHERE THESE HAVE BEEN WIRED ON SPARE EXCHANGE LINE RELAY SET SHELF JACKS.
 - 7 TO BUSY REMOVE LINK FROM TJ7-8 AND TJ13-14 AND PLACE IN TJ1-2 AND TJ11-12.

FROM ACCESS START RELAY CONTACT OR U19 OF PRECEDING FINDER CCT

FROM U17 IN NEXT FINDER CCT

TO MARKER CIRCUIT GBW13230 OR EQUIV

BATT BK 0.7mm FUSE [2B2] U12 - FIG 1B - EFe

ETH R. 0.7mm ETH BAR [2A2] U15 U11 - FIG. 1B - EFe, J1-R1a

ETH R U11-ST21-BR23-BR1-SA21-H21-ET1-ET4

BATT W U12-G2-ST2-BR2-BR2-H2

TO MISCELLANEOUS CIRCUIT GBW 14721 OR EQUIV.

TO ATTENDANTS CABINET GBW 13242 OR EQUIV.

79
81
80
82

NOTE 6


FIRST USED NZ FOREST SERVICE

W 50V

FINDER CIRCUIT

120, 135 & 149 TYPE PABX'S

A 28-7-80 DTM TG 193657 VBJ WJH		ISS DATE DEL DC ORDER CKD APPD		CHANGE	
DRN: DTM	CKD: VBJ	ORIGIN: T-EQPT			
TCD: DTM	APPD: WJH	STANDARD: ATW 22001			
NZPO ENGINEER-IN-CHIEF, WELLINGTON					
SHT 1 OF 1		SIZE A2		GBW 16850 MOD A	

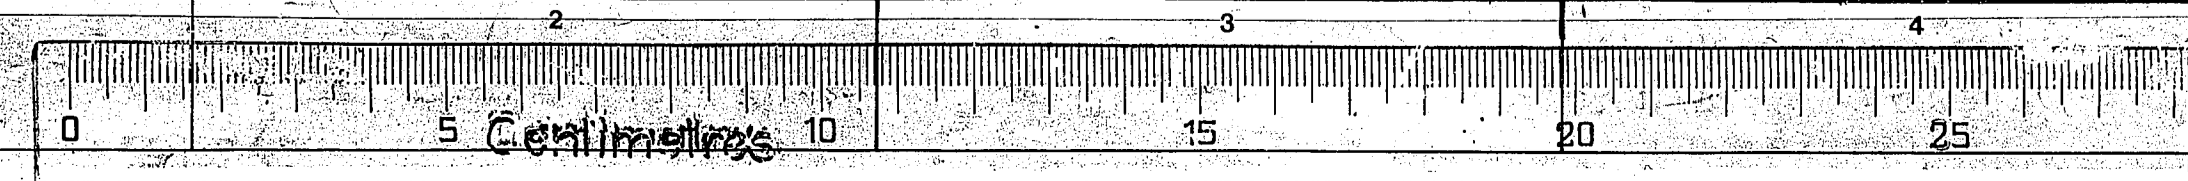

UD 236

16