

RELAY CODES & COMPONENTS LIST **GBW 17230**  
 AUTOMATIC TELEX SYSTEM  
 SERVICE SIGNAL AND SIGNAL PHASING  
 PULSE DISTRIBUTION.


RELAY	B.C.C. CODE	DIAG. FIG.	NOTES	COMPT. DESIGN	B.P.O. CODE	NOTES
D	TMC4H7	1A,4A		RIA,RIB	Nº 9	} FIGS. 1A & 4A.
				RIC,RID	"	
DF	76205P	1A,4A		R2A,R2B	"	
				R2C,R2D	"	
ST	6044	1A,4A		R4	"	
PP	76204P	7A		R5	Nº 16GE	
				R6	Nº 16GD	
ST	6001	7A		R7,R8	Nº 16GE	
Z	5277	7A		R9,R10	"	
				R11	"	
PP	76203	8A		C1,C2	102C	} VALVEHOLDER Nº 38
				C3+R3	Nº 102C + Nº 6	
ST	6001	8A		C4,C5	Nº 115	
				C6	115	
				C7	119	
				VI	CV 491	
				LFI	Nº 3/28A	
				TJ	1A	
				R1,R2	Nº 9	
				R3,R4	9	
				RIA,RIB	9	} FIGS. 2A & 3A
				R2A,R2B	9	
				R7A,R7B	9	
				R8A,R8B	9	
				KD0+KDE	320	} FIG. 3C.
				R5,R6	Nº 9	

Continued on sheet 2.


NOTES - A SPECIAL FACTORS OF SAFETY. B SPECIAL ADJUSTMENTS. C CCT POINTS OR MODIFICATIONS

LAYOUT


FIGS. 1A & 4A.

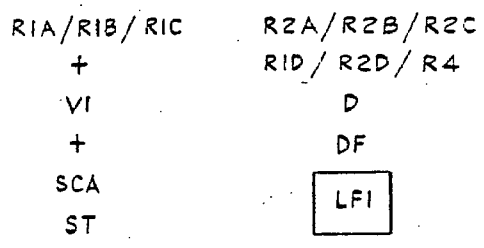

CAPACITOR BOX.

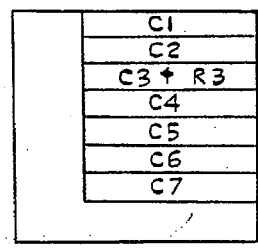

SCA

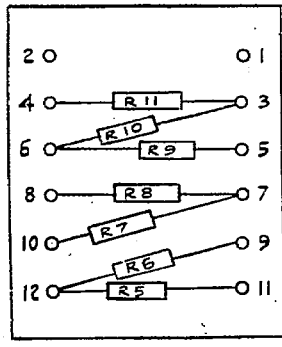

N.Z.P.O. (54508) 10-10-62. B.G.

ISSUE 15-8-62  
 R5-R11 WERE CARBON Nº 12.  
 VI WAS CY2007 (30383)  
 2 27-3-72 ADP

ORIGINATED BY	ET
DATE	15-8-62
SIGNED FOR COMMITTEE	

5 Centimetres

15

20

25

30

